



! When the arm with rubber bedding is replaced by the improved version, replace both left and right arm !

Track Control arm
BMW (E36)

Sidem Nr.
21370 R
21371 R

Reference nr.
31 12 6 758 513
31 12 6 758 514

Problem:

- Early wear of rubber bedding Ball Joint.
- Play on ball joint.


Cause:

- Weak connection by rubber between inner and outer bushing.
- When replacing a ball joint, special equipment is needed to press it in the arm to prevent damage.
- Damaged dustcover.

Solution:

- A new ball joint is progressed without the rubber core.
- A cover is added to protect the pin and the dustcover during transport and storage.

Original:

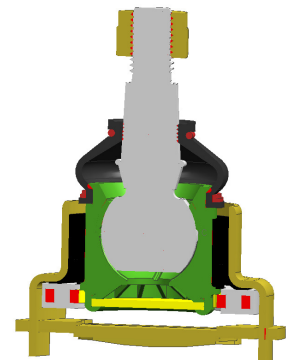

Improved:

