

Track Control arm
BMW (E46)

Sidem Nr.

21278 R

21279 R

Reference nr.

31 12 6 777 851 R

31 12 6 774 820 R

Problem:

- Early wear of rubber bedding Ball Joint.
- Play on ball joint.

Cause:


- Weak connection by rubber between inner and outer bushing.
- Damaged dustcover.

Solution:

- A new ball joint is progressed without the rubber core.
- A cover is added to protect the pin and the dustcover during transport and storage.

! When the arm with rubber bedding is replaced by the improved version, replace both left and right arm !

Original:

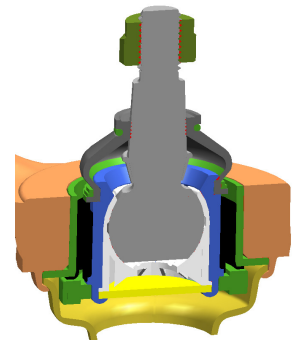

Improved:

