



Mercedes C-class (203) arms reengineered




	Sidem Nr	OE Number
Mercedes	49976	204 330 43 11
Track Control Arm	49977	204 330 44 11
	49978	204 330 19 11
	49979	204 330 20 11

Problem:

- Premature play on ball-joint.

Cause:

- Due to the 2 enclosed rings that close the assembly, tolerances cannot be kept as small,
- this can cause instability-play in extreme conditions.

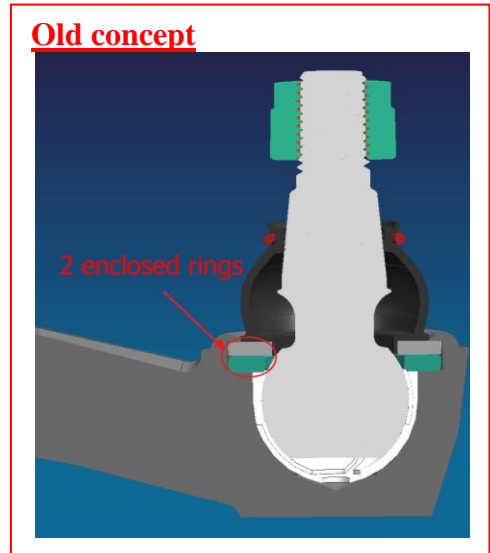

Solution:

- Classic design with only 1 enclosed ring where the DC is attached on a classical way
- So the closing ring is in direct contact with the insert what offers a more stable-rigid assembly.

