



# SIDEM SOLUTIONS



## Improved track control arm Audi, Seat, Skoda and Volkswagen



	SIDEM	APPLICATION	N° OE
37672/73	track control arm	Audi A4/S4/A6, Seat Exeo, Skoda Superb, VW Passat	8E0 407 505/6 P
37670/71			4D0 407 509/10 K
37972/73			8E0 407 509/10 P
37070/71			8K0 407 509/10 A
37078/79			8K0 407 505/6 A

### PROBLEM

- Play on ball joint

### CAUSE

- Due to its location, the track control arms are exposed to all kind of external influences. When a dustcover is damaged or is not fitting perfectly, water and dirt finds its way into the joint. This causes oxidization of the ball pin, which leads to wear of the plastic cup.



### SOLUTION

- A new dustcover is designed with a perfect fit along the rod.
- A new rod is designed with a improved neck shape to ensure tight closing of the dustcover during movement.

