




	Sidem Nr	OE Number
Mercedes	49976	204 330 43 11
Track Control Arm	49977	204 330 44 11
	49978	204 330 19 11
	49979	204 330 20 11

Problem:

- Premature play on ball-joint.

Cause:

- Due to the 2 enclosed rings that close the assembly, tolerances cannot be kept as small.
- This can cause instability-play in extreme conditions.

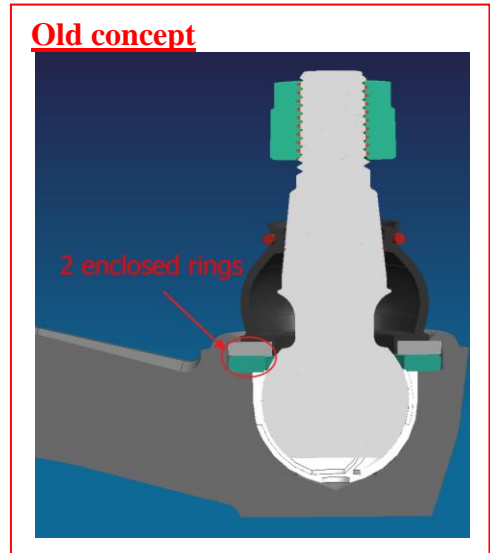

Solution:

- Classic design with only 1 enclosed ring where the DC is attached on a classical way
- So the closing ring is in direct contact with the insert what offers a more stable-rigid assembly.

