



SIDEM		APPLICATION	OE-NR.
801620	Silent block	Ford Mondeo / Jaguar X-Type	1 311 417* / C2S 39662*
809631	Silent block	Opel / Vauxhall Corsa - Combo - Meriva - TwinTop	3 52 366 / 9 199 961
809633	Silent block	Opel / Saab / Fiat / Vauxhall	3 52 319 / 12 786 412 / 717 40 107 / 93 171 448
809643	Silent block	Opel / Vauxhall Insignia	3 52 868 / 13 257 785
821627	Silent block	BMW - 5 Serie E39	31 12 9 068 753
849626	Silent block	Mercedes C-Class - CLK-Class - GLK-Class	203 333 10 14
863619	Silent block	Audi A4 - A6 - A8 / Skoda Superb / VW Passat	4D0 407 183 AC

PROBLEM




- Early wear of OE hydraulic silentblocks due to leaking making the car more difficult to handle



CAUSE

- The hydraulic silentblock has a thin, fragile layer of rubber on the outside. When this is punctured, the hydraulic fluid starts leaking and in no time all the resistance of the silentblock is lost

OE

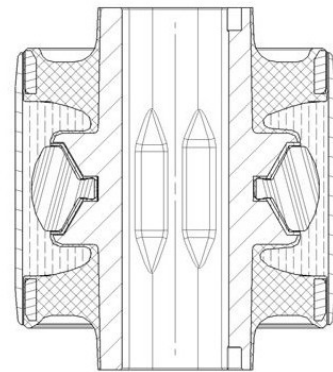

SOLUTION

- When the OE-concept of hydraulic silentblocks shows many failures we choose to use full rubber silentblocks.

RESULT



- Significant longer lifetime without reduced driving comfort.

SIDEM

